

Work Order ID 97067

\*97067\*

Page 1

February 14 13 1:32:25 PM

Item ID: D350-748-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop. \*NS2\*

Item Name: Crosstube Installation, High Aft.

Start Date: 2/14/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Run Start \*NR1\*

Stop \*NR2\*

Approvals:

Process Plan: ML5Date: 130215

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

Draw Nbr

Revision Nbr

D350-748-241

G

0.00

100

\*100\*

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile &amp; type labels per PPPD350-748-201

CHG003

0.00

110

\*110\*

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo


Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT

\*\*\*\*\*UNDER BEND .225" PER SIDE\*\*\*\*\*

\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*

0.00

0.00

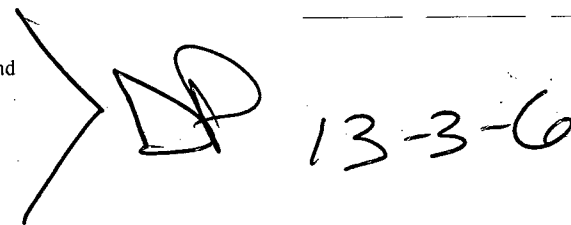

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

Work Order ID 97067

\*97067\*

Page 2

February-14-13 1:32:25 PM

Item ID: D350-748-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start \*NR1\*

QC: Date: SPC (Y/N): Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

QC6- Inspect dimensions to drawing

0.00

\*120\*

QC

Quality Control

Memo

0.00

\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*

125

0.00

\*125\*

Outsource1

Outsource process - Heat Treat

Memo

0.00

ISSUE P/O TO METCOR:

\*\*\*Stress relief\*\*\*

Heat treat crosstube as per QSI010 4.3

Temp: \_\_\_\_\_

Start time: \_\_\_\_\_

Finish time: \_\_\_\_\_

126

Receive & Inspect for Damage & Mat'l Certs

0.00

\*126\*

Packaging

Packaging

Memo

0.00

8/3/13

P/O: 19271  
metcor

CL 13/03/07 ①

143/3/14 ①

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 97067

\*97067\*

Page 3

February-14-13 1:32:25 PM

Item ID: D350-748-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

127

QC15- Crosstube Dimensional Check

8.3/3/13

0.00

\*127\*

QC

Memo

\*\*\*MARK CUT LINES\*\*\*

Quality Control

cat cuffs at FAZ sheet height 13-03-13  
 verify height 3.460 ac 15 inspector 8/3/14  
 verify thrust 0.027" ac 15 inspector 8/3/14

130

\*130\*

Crosstubes

Crosstubes

Memo

0.00

- 1- Cut tube as per inspection sheet.
- 2- Drill Tube as per Dwg D350-748-241 Using DT8876 Drill Jigs,  
Set-up drill table as per QSI 010

3-Deburr

4- Engrave Part # and Batch # as per Dwg D350-748-241

5-Remove all marks from tube within limits of D350-748-241

6- Apply a light coat of LPS3 on the interior of tube

Batch: \_\_\_\_\_

13-03-14

13-03-19

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Misabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

# Work Order ID 97067

\*97067\*

Page 4

February-14-13 1:32:25 PM

Item ID: D350-748-201 Accept \*N900040100\* Setup Start \*NS1\*  
 Revision ID: Stop \*NS2\*  
 Item Name: Crosstube Installation, High Aft  
 Start Date: 2/14/13 Start Qty: 1.00 \*1\* Cust Item ID:  
 Required Date: 3/08/13 Req'd Qty: 1.00 \*1\* Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start \*NR1\*  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

QC6- Inspect dimensions to drawing

0.00

DAS 16 13/03/20

\*140\*

QC

Memo

Quality Control

150

Outsource process-Cadplate per QSI017 4.1.9.1

0.00

\*150\*

Outsource3

Outsource process - Cad plate

Memo

Issue P/O: 19388  
 Stress relief at 375° for 5 hours  
 Magnetic Particle Inspect per ASTM E1444  
 Cadum Plate per AMS-QQ-P-416B, Class 1, Type 2  
 Embrittle relief at 375° for 8 hours, Chromate Treat  
 Possible Supplier: Southwest United Industries  
 Ensure Certificate of Conformity is attached

0.00

CD 13/03/21 ①  
 P.19388 CD 13/05/03 ①

160

Receive & Inspect for Damage & Mat'l Certs

0.00

\*160\*

Packaging

Packaging

Memo

Ensure certificate of conformity is attached

0.00

1X 13/01/12 SP  
 13-4-11

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other



Work Order ID 97067

\*97067\*

Page 5

February-14-13 1:32:25 PM

Item ID: D350-748-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

170

QC5- Inspect part completeness to step on W/O

0.00

\*170\*

QC

0.00

Quality Control

Memo

XE inspect re grinds  
8/13/05/03

DAS  
16  
2-83 13/04/14

172

0.00

\*172\*

Crosstubes

Memo

0.00

Crosstubes

\*\*\*LOAD TEST TO 3000LB FOR 1 MINUTE\*\*\*

13-4-12  
9/13/4/12

1 13/05/16

174

Outsource process - NDT per QSI038.4.1

0.00

\*174\*

Outsource2

Memo

0.00

Outsource process - NDT

ISSUE P/O TO ACCUREN: 19585

19926

CZ 13/04/15 ①

CZ 13/05/17 ①

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

**Work Order ID 97067**

February-14-13 1:32:25 PM

**\*97067\***

Page 6

Item ID: D350-748-201

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
176	Receive & Inspect for Damage & Mat'l Certs	0.00							
<b>*176*</b>									
Packaging	Memo	0.00							
Packaging									
178	QC5- Inspect part completeness to step on W/O	0.00							
<b>*178*</b>									
QC	Memo	0.00							
Quality Control									
180		0.00							
<b>*180*</b>									
SprayPaint	SprayPaint	0.00							
Spray Painting	Memo								
	1-Prime inside crosstube as per QSI 005 4.2								
	BATCH: 125264								
	2-Paint Outside of Tube as per Dart QSI 005 4.2								
	BATCH: 125473								

4/3/14 (1)  
4/3/12 (1)

(DAS 05 9-89) 13-05-18

(DAS 05 9-89) 13-05-19

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General		
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset	<input type="checkbox"/> Pressure/Forced
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Weld
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Wrong Stock Pulled
			<input type="checkbox"/> Other

# Work Order ID 97067

\*97067\*

Page 7

February-14-13 1:32:25 PM

Item ID: D350-748-201

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

190

QC14- Inspect Spray Paint

0.00

\*190\*

QC

Quality Control

Memo

Then, Wrap in plastic bag to protect from scratches

0.00

200

0.00

\*200\*

Crosstubes

Crosstubes

Crosstubes

Memo

1-Install Ground wire Insert, then insert screw and washer

2-Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe

3-Install supports with Proseal 890 per and QSI 015  
A/R Proseal 890 Batch: 124856

4-Install supports clamps Using Dt8876 as per Dwg D350-748-241, Torque to 60-80 IN-LBS

1 0 0 13-5-26

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div> <input type="checkbox"/> Rework  <input type="checkbox"/> Scrap  <input type="checkbox"/> Use-as-is  <input type="checkbox"/> Work Order Update         </div> <div> <input type="checkbox"/> Skid-tube  <input type="checkbox"/> Machining  <input type="checkbox"/> Thermoforming  <input type="checkbox"/> Large Fab         </div> <div> <input type="checkbox"/> Crosstube  <input type="checkbox"/> Small Fab  <input type="checkbox"/> Finishing  <input type="checkbox"/> Composite         </div> <div> <input type="checkbox"/> Water Jet  <input type="checkbox"/> Prod. Eng. Coord.  <input type="checkbox"/> Rec/Store/Packaging  <input type="checkbox"/> Supplier         </div> <div> <input type="checkbox"/> Engineering  <input type="checkbox"/> Quality  <input type="checkbox"/> Other         </div> </div>
--	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

# Work Order ID 97067

\*97067\*

Page 8

February-14-13 1:32:25 PM

Item ID: D350-748-201

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Run Start

\*NR1\*

Approvals:

Process Plan:

Date:

Tooling:

Date:

Stop

\*NR2\*

QC:

Date:

SPC (Y/N):

Date:

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

210

QC5- Inspect part completeness to step on W/O

0.00

\*210\*

inspect only 22 hours after

0.00

QC

Memo

Quality Control

Assembly

220

Pick Kit

0.00

\*220\*

Packaging

0.00

Packaging

Memo

230

QC4- 100% Inspect kits for completeness

0.00

\*230\*

QC

0.00

QC

Memo

Quality Control

DAS  
05  
9-89 13-05-28

DAS  
06  
9-89

Shp  
13529

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other



# Work Order ID 97067

February-14-13 1:32:25 PM

**\*97067\***

Page 9

Item ID: D350-748-201 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Crosstube Installation, High Aft  
 Start Date: 2/14/13 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 3/08/13 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240	Packaging	0.00							
<b>*240*</b>									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPPD350-748-201								
	Location: _____								
	PPP Rev: _____								
250	QC21- Final Inspection - Work Order Release	0.00							
<b>*250*</b>									
QC	Memo	0.00							
Quality Control									



1 ~~2~~ 13-5-31

MC 13-05-31

W 13-05-31

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											

FAULT CATEGORY			
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

# Picklist Print

February-14-13 10:48:55 AM

Page 1

Work Order ID: 97067

Parent Item: D350-748-201

Parent Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13

Required Date: 3/08/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev: A New Issue 06-07-05 JLM  
 IPP Rev: B Update qty of MS21042L5 06-09-12 KJ  
 IPP Rev C Combined manufacturing 08.04.02 EC verified by: DD  
 IPP Rev:D 08-06-24 revD as per dwg DD verified by:EC  
 IPP Rev: E 08.12.11 Step17 was step 21 KJ Verified by:EC IPP Rev:F 10.08.04 added QSI010  
 4.3 DD ver:EC IPP REV:G ADD UNDER BEND COMMENT 12-05-28 JLM IPP  
 REV:H 12.11.05 as per dwg D350-748-141G DD ver:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
ALS4-1032-225 Insert		Purchased	No			200	Each	2,689.0000	1	1		13-5-26	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				FP001		1223							
				118386		55							
				118966		68							
				120410		10							
				120451		13							
				121269		77							
				122827		1000							
				ST280		1466							
				118520		466							
				124468		1000							
AN4-41A Bolt		Purchased	No			220	Each	640.0000	8	8			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				ST359		9							
				123346		9							
				ST514		300							
				124241		300							
				ST515		331							
				120423		150							
				121185		181							

JMP

120423 M/LD

13/05/28

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Misabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

# Picklist Print

February-14-13 10:48:55 AM

Page 2

Work Order ID: 97067

Parent Item: D350-748-201

Parent Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13

Required Date: 3/08/13

Start Qty: 1.00

Required Qty: 1.00

**AN4-6A** Purchased No

220 Each 3,234.0000

16 16

Location Loc Qty Loc Code

ST355 206

123355 206

ST514 3028

123355 3028

**AN5-32A** Purchased No

220 Each 514.0000

4 4

Location Loc Qty Loc Code

ST337 514

122800 50

123522 80

124215 384

**AN960JD10** NAS1149D0363J Purchased No

200 Each 0.0000

1 1

**AN960JD416** NAS1149D0463J Purchased No

220 Each 0.0000

32 32

**AN960JD516** NAS1149D0563J Purchased No

220 Each 2.0000

8 8

Location Loc Qty Loc Code

ST504 2

1069059 2

123355 M.I.D.

124800 M.I.D.

13-5-26

124778 M.I.D.

123248

13/05/28

February-14-13 10:48:55 AM

Shop Packet Print

Page 2

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>				
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector	
Doc/Data										
Equip/Tooling										
Operator										
Material										
Setup										
Other										
Process										
Supplier										
Training										
Unapproved										

FAULT CATEGORY											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

# Picklist Print

February-14-13 10:48:55 AM

Page 3

Work Order ID: 97067

Parent Item: D350-748-201

Parent Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13

Required Date: 3/08/13

Start Qty: 1.00

Required Qty: 1.00

D3500-1  
Saddle

Manufactured No

220 Each 145.0000

4

## Location

## Loc Qty

## Loc Code

ST243 40  
95067 40  
ST423 75  
86763 26  
88346 21  
89220 12  
90055 12  
90734 4  
ST429 30  
94619 30

B 86763 M/D 13-5-28

D3501-1  
Bushing

Manufactured No

220 Each 1,003.0000

16

## Location

## Loc Qty

## Loc Code

ST043 160  
86913 160  
ST053 843  
88532 383  
94765 60  
95165 400

B 95165 M/D 13-05-28  
13-5-26

D3502-1  
Support

Manufactured No

200 Each 137.0000

2

2

## Location

## Loc Qty

## Loc Code

LG051 137  
73419 3  
74873 1  
86876 39  
88465 24  
94722 20  
95130 50

(2)

February-14-13 10:48:55 AM

Shop Packet Print

Page 3

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div> <input type="checkbox"/> Rework  <input type="checkbox"/> Scrap  <input type="checkbox"/> Use-as-is  <input type="checkbox"/> Work Order Update         </div> <div> <input type="checkbox"/> Skid-tube  <input type="checkbox"/> Machining  <input type="checkbox"/> Thermoforming  <input type="checkbox"/> Large Fab         </div> <div> <input type="checkbox"/> Crosstube  <input type="checkbox"/> Small Fab  <input type="checkbox"/> Finishing  <input type="checkbox"/> Composite         </div> <div> <input type="checkbox"/> Water Jet  <input type="checkbox"/> Prod. Eng. Coord.  <input type="checkbox"/> Rec/Store/Packaging  <input type="checkbox"/> Supplier         </div> <div> <input type="checkbox"/> Engineering  <input type="checkbox"/> Quality  <input type="checkbox"/> Other         </div> </div>	
--	--	--	--	--	--



# Picklist Print

February-14-13 10:48:55 AM

Work Order ID: 97067

Parent Item: D350-748-201

Parent Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13

Required Date: 3/08/13

Start Qty: 1.00

Required Qty: 1.00

D350-748-241TRN  
Crosstube Turning Detail

Manufactured No

110 Each 6.0000

1

SAD 13-07-05

Location	Loc Qty	Loc Code
LG	3	
79394	1	
89098	1	
89962	1	
LG014	3	
79392	1	
86988	1	
91184	1	

\$94893

①

D3595-063-395  
RUBBER CUSHION

Manufactured No

200 Each 183.0000

2

2

AL 13-5-26

Location	Loc Qty	Loc Code
FG	5	
87353	5	
LG051	178	
87353	17	
94602	1	
94603	25	
95060	105	
95803	30	

②

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div> <input type="checkbox"/> Rework  <input type="checkbox"/> Scrap  <input type="checkbox"/> Use-as-is  <input type="checkbox"/> Work Order Update         </div> <div> <input type="checkbox"/> Skid-tube  <input type="checkbox"/> Machining  <input type="checkbox"/> Thermoforming  <input type="checkbox"/> Large Fab         </div> <div> <input type="checkbox"/> Crosstube  <input type="checkbox"/> Small Fab  <input type="checkbox"/> Finishing  <input type="checkbox"/> Composite         </div> <div> <input type="checkbox"/> Water Jet  <input type="checkbox"/> Prod. Eng. Coord.  <input type="checkbox"/> Rec/Store/Packaging  <input type="checkbox"/> Supplier         </div> <div> <input type="checkbox"/> Engineering  <input type="checkbox"/> Quality  <input type="checkbox"/> Other         </div> </div>
--	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions  <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	---	--

# Picklist Print

February-14-13 10:48:56 AM

Page 5

Work Order ID: 97067

Parent Item: D350-748-201

Parent Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13

Required Date: 3/08/13

Start Qty: 1.00

Required Qty: 1.00

MS2104214

Purchased

No

220

Each

5,581.0000

24

24

Nut

## Location

## Loc Qty

## Loc Code

FP001 318  
122452 306  
8182 12  
FP-001 12  
8182 12  
GA 221  
121444 221  
ST314 530  
116548 12  
119017 20  
123248 482  
123355 16  
ST506 1500  
123900 1500  
ST518 3000  
124231 3000

125535

M.H.D.

50

SM

MS2104215

Purchased

No

220

Each

1,085.0000

4

4

Nut

## Location

## Loc Qty

## Loc Code

ST314 385  
108827 4  
116548 43  
119109 20  
121652 12  
122452 294  
2937 12  
ST506 700  
123900 700

125654

M.H.D.

Ref

SM

13/05/28 MD

February-14-13 10:48:56 AM

Shop Packet Print

Page 5

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other

# Picklist Print

February-14-13 10:48:56 AM

Page 6

Work Order ID: 97067

Parent Item: D350-748-201

Parent Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13

Required Date: 3/08/13

Start Qty: 1.00

Required Qty: 1.00

MS21920-22 Purchased No

200 Each 114.0000 2 2

AP 13-5-26

Clamp(per MIL-DTL-8783C)

Location

Loc Qty

Loc Code

LG050

114

116207

7

117506

1

118186

8

119545

1

120631

3

124260

46

124522

48

MS27039-1-10

Purchased No

200 Each 364.0000 1 1

AP 13-5-26

Screw

Location

Loc Qty

Loc Code

GA

100

120449

100

ST305

1

122815

1

ST308

18

123522

18

ST506

245

124326

245

February-14-13 10:48:56 AM

Shop Packet Print

Page 6

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div>             Rework <input type="checkbox"/>              Scrap <input type="checkbox"/>              Use-as-is <input type="checkbox"/>              Work Order Update <input type="checkbox"/> </div> <div>             Skid-tube <input type="checkbox"/>              Machining <input type="checkbox"/>              Thermoforming <input type="checkbox"/>              Large Fab <input type="checkbox"/> </div> <div>             Crosstube <input type="checkbox"/>              Small Fab <input type="checkbox"/>              Finishing <input type="checkbox"/>              Composite <input type="checkbox"/> </div> <div>             Water Jet <input type="checkbox"/>              Prod. Eng. Coord. <input type="checkbox"/>              Rec/Store/Packaging <input type="checkbox"/>              Supplier <input type="checkbox"/> </div> <div>             Engineering <input type="checkbox"/>              Quality <input type="checkbox"/>              Other <input type="checkbox"/> </div> </div>
--	--


Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
---	---	---	---

DART AEROSPACE LTD		Work Order:	97067
Description: Crosstube High Aft (AS350/355)		Part Number:	D350-748-201
Inspection Dwg: D350-748-241	Rev: 16	Page 1 of 1	

Required Dimension	Min	Max
Height	31.22	31.48
1/2 Span	40.77	41.03
Angle	75	77
Total Span	81.54	82.06
Bending Passes	7	--
Crushing	--	6%
Twist	--	0.25

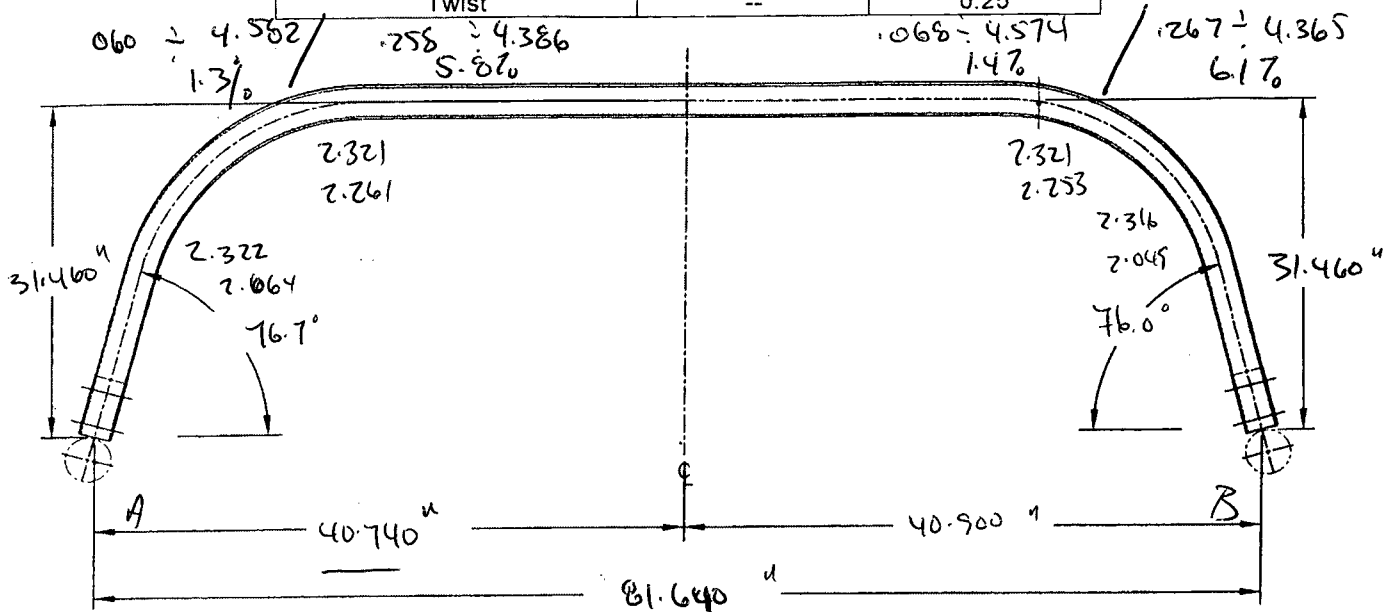

	Side A	Side B
Bending Passes		
Crushing		
Comments		
Side A = 1.3% crush @ top + 5.8% at Bottom		
Side B = 1.4% crush @ top + 6.1% at Bottom		
cut cuff @ 31.460" height 8/3/12		

QC15 Inspection	8
Date	13/3/13

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	10.08.23	Dwg Rev updated	KJ	
C	12.04.16	Added bending, crushing & twist dimensions	KJ	
D	12.07.31	Dwg Rev updated	KJ	

Item	Qty -241	Part Number	Description
1	X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
2	1	D6015-125	CROSSTUBE (OR D6018-125)
3	2	D3502-1	SUPPORT
4	2	D3595-063-395	RUBBER CUSHION
5	1	AELS-1032-225	INSERT
6	1	NAS1149D0363J	WASHER (OR AN960JD10)
7	2	MS21920-22 OR MS21920-21	CLAMP (PER DART SPEC. M-MS21920-21/-22)
8	1	MS27039-1-10	SCREW
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6015-125 OR D6018-125  
FINISHED LENGTH AFTER TURNING =  $124.70 \pm 0.06$  (AFTER BENDING/TRIMMING = 122.70 REF)
- 2) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2  
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.  
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2  
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-241" AND BATCH NUMBER ON INSIDE OF CUFF  
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 29.85 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.297 HOLE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

#### TURNING

- 10) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 11) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS2759/1E AFTER TURNING. ACCEPTABLE TO VERIFY TENSILE STRENGTH BY HARDNESS TEST PER ASTM E18 TO 40-45 HRC.

#### BENDING

- 12) ALL DIMENSIONS FOR BENT TUBE ARE POST STRESS RELIEF
- 13) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ON TOP HALF OF BEND, AND 7% ON BOTTOM HALF OF BEND.
- 14) MAX AMPLITUDE OF RIBBLING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- 15) AFTER BENDING, STRESS RELIEVE TUBE AT  $650^{\circ}\text{F} \pm 0.25^{\circ}\text{F}$  FOR A MINIMUM OF 2 HRS AND ALLOW TO COOL TO AMBIENT TEMPERATURE (REF AMS2759/1E).
- 16) MAX TWIST AFTER STRESS RELIEF: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

#### ASSEMBLY

- 17) TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 18) TORQUE CLAMPS 60 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP  
RELEASE  
ENGINEER  
UNCONTROLLED  
SUBJECT TO APPROVAL  
WITHOUT NOTICE  
WORK ORDER  
NO. 97067 MJS

13-02-15

RELEASE  
2012-11-01

G	RMV ABRASION STRIP, SUPPORT NOW W/ PROSEAL & CUSHION, ADD STRESS RELIEF, LONGER CUFF, NOW TRIMD AFTER BEND, ADD WALL DIMS & UPDATE TOL.	CP	12.09.12
F	ADD HRC TEST OPTION (B8-1) PER PAR 09-040, ADD TWIST LIMIT (A8-1, C1-3), ADD D6015-125 OPTION (C8-1), STOCK DIM NOW MACHINED (D1-4)	CP	10.11.23
E	REVISE GENERAL NOTES; UPDATE TO CURRENT STANDARDS: RELOCATED FLAG #6 PER PAR 08-046 (ZN A8-3); ADD TOLERANCES (ZN C6-3, D2-3)	RF	09.09.30
D	MAG. PARTICLE AND CAD PLATE AS MFD.	CP	06.10.31
C	ADD CAD PLATING	CP	06.08.14
B	ADD D6018-125 & PRIME AND PAINT	CP	06.06.30
A	NEW ISSUE	CP	06.03.31
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	12.09.12		


**DART AEROSPACE LTD**  
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. G  
D350-748-241 SHEET 1 OF 4  
TITLE SCALE  
CROSSTUBE (AS 350/355 HI AFT) NTS


COPYRIGHT © 2006 BY DART AEROSPACE LTD  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



97067

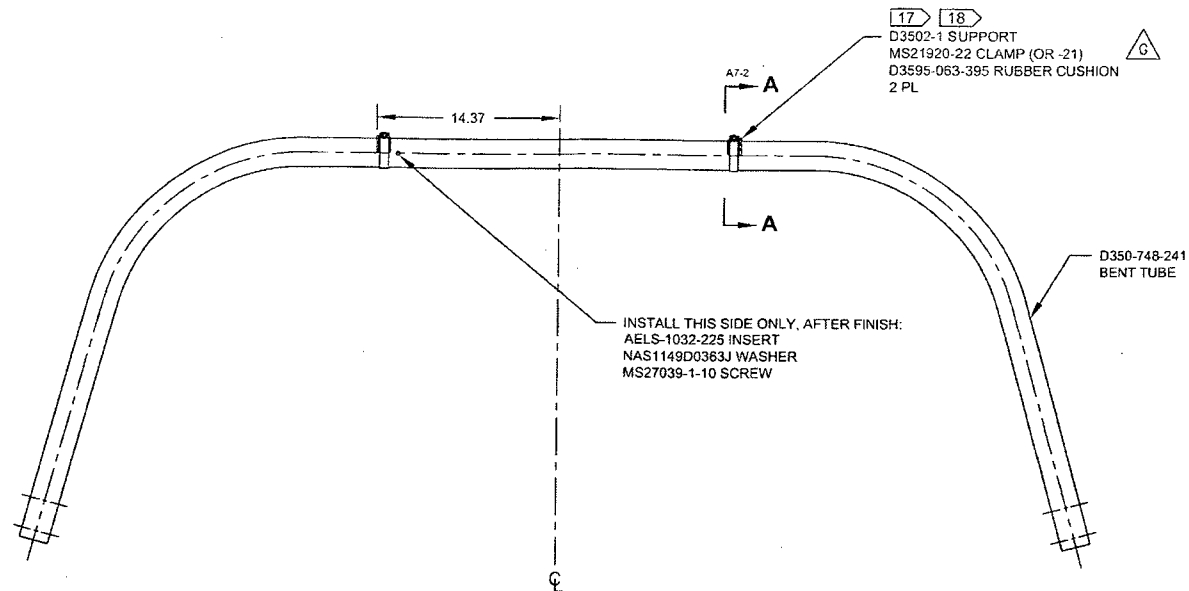

**D350-748-241  
ASSEMBLY DETAIL**

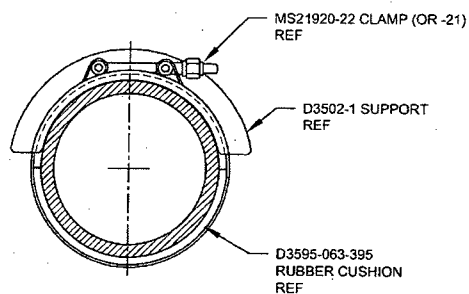


**SECTION A-A D4-2  
SCALE 6X**

RELEASED  
2012-11-01

DESIGN	90	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
DRAWN	90		
CHECKED	AS	DRAWING NO.	REV. G
MFG. APPR.	AS	D350-748-241	SHEET 2 OF 4
APPROVED	AS	TITLE	SCALE
DE APPR.	AS	CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	12.09.12	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

97067

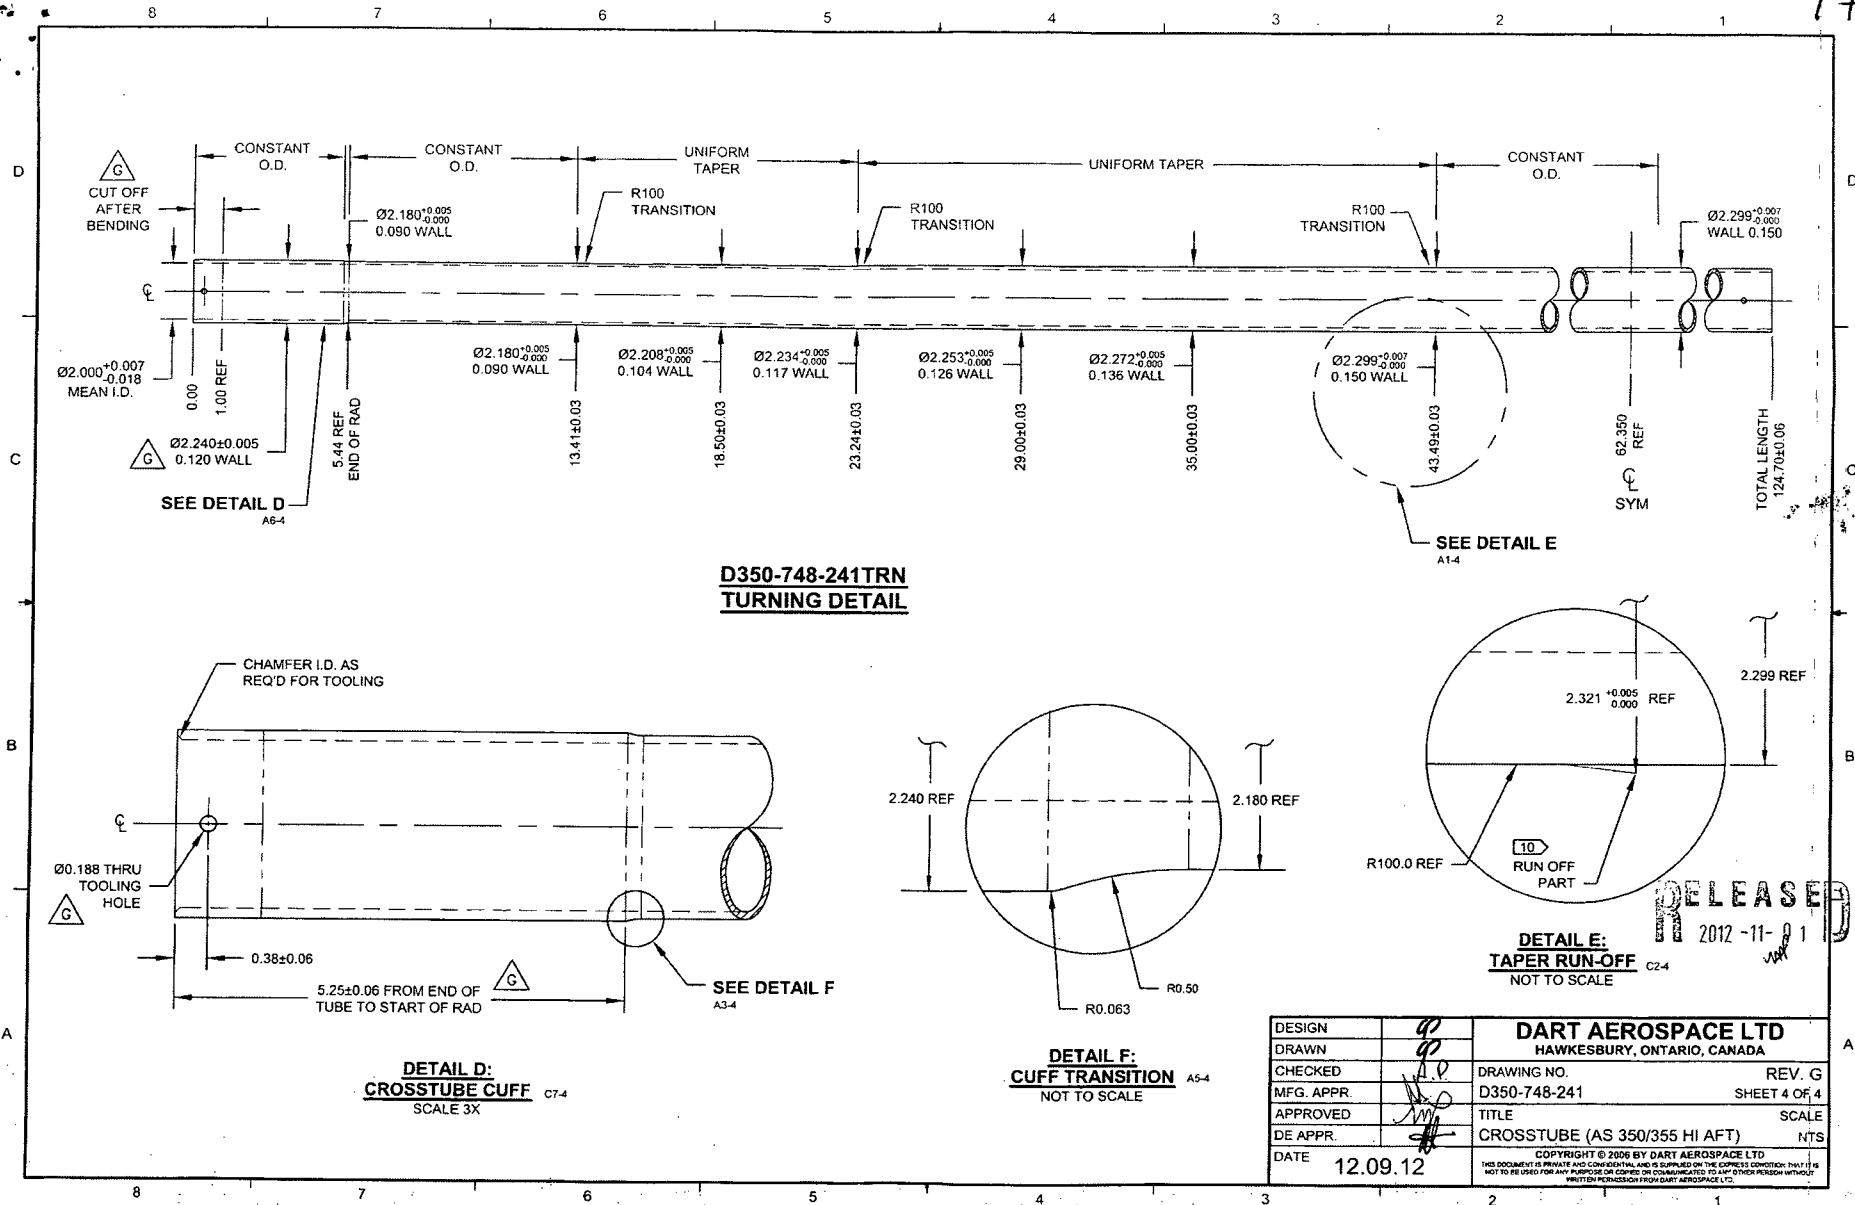


RELEASED  
2012-11-01

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D350-748-241	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI AFT)	NTS
DATE	12.09.12	<small>COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMED ON COMMERCIAL TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

*Measured Before De-Stress*

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b> 97067
<b>Description:</b> Crosstube High Aft (AS350/355)		<b>Part Number:</b> D350-748-201
<b>Inspection Dwg:</b> D350-748-241	<b>Rev:</b> G	<b>Page 1 of 1</b>

Required Dimension	Min	Max
Height	31.22	31.48
1/2 Span	40.77	41.03
Angle	75	77
Total Span	81.54	82.06
Bending Passes	7	--
Crushing	--	6%
Twist	--	0.25

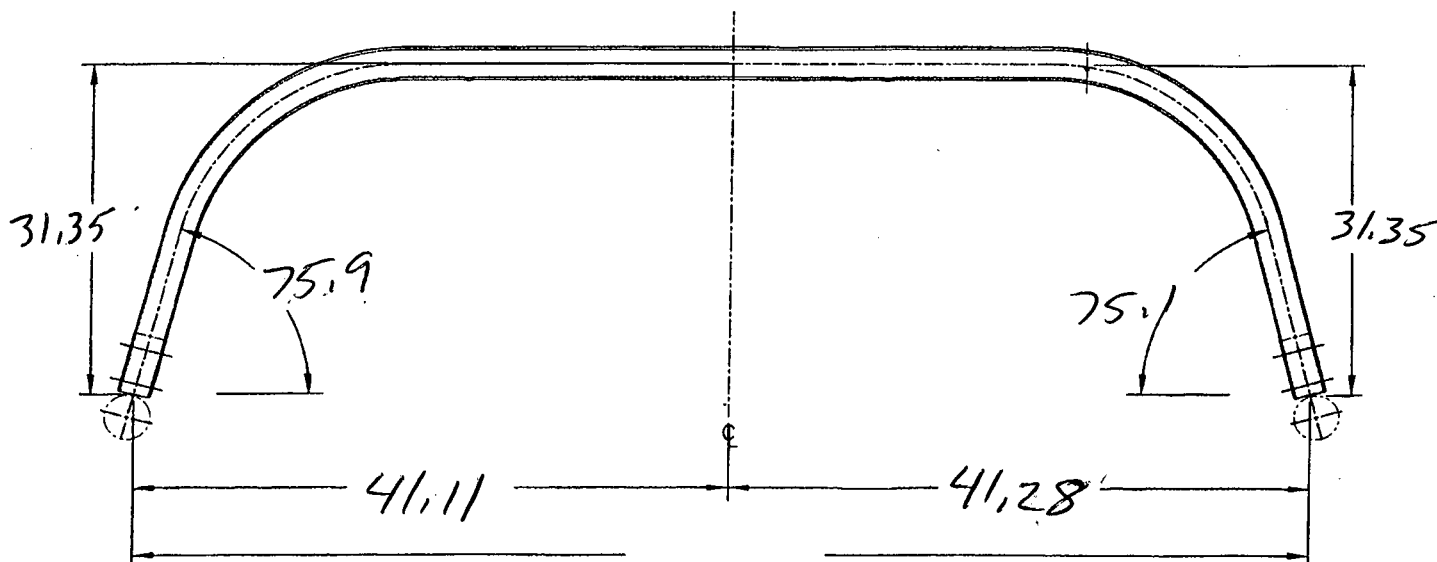

	Side A	Side B
Bending Passes	37	39
Crushing		
Comments		
TWIST - 0.065		

*13-3-6*

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	10.08.23	Dwg Rev updated	KJ	
C	12.04.16	Added bending, crushing & twist dimensions	KJ	
D	12.07.31	Dwg Rev updated	KJ	
E	13.02.27	Dwg Rev updated	KJ	

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____ Part No. _____ NCR No. _____	<b>DISPOSITION</b> Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b> <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	---	---

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief.Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabel <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
---	---	---	---

# METCOR INC.

560 BOUL. ARTHUR-SAUVÉ  
ST-EUSTACHE, QC, J7R 5A8

Tel: 450-473-1884 / Fax: 450-491-5498

## Certificat de Conformité Détaillé

Detailed Certificate of Compliance

BON DE TRAVAIL order	CHARGEMENT load
184354	1

CLIENT / customer 215

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

LIVRÉ À / shipped to:

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

1

COMMANDE DU CLIENT customer po	BON DE LIVRAISON DU CLIENT customer shipper no.	MATÉRIEL material	CODE DE TRAITEMENT mat'l heat code	NUMÉRO DE LOT lot number
PO19271		Steel		

### SPÉCIFICATIONS DU PROCÉDÉ processing specifications

STRESS REL

SAE AMS 2759/1 REV.E

EXIGENCE / requirement	SPÉCIFICATIONS / specified	TESTS EXÉCUTÉS / performed	RÉSULTATS DE TESTS / results
Visual			

QUANTITÉ quantity	POIDS weight	DESCRIPTION DES PIÈCES parts description
5	150	D350-748-101 CROSSTUBE (1) CROSSTUBE REFERENCE 95040  (1) D350-748-101 CROSSTUBE REFERENCE 95042  (1) D350-748-101 CROSSTUBE REFERENCE 95041  (1) D350-748-201 CROSSTUBE REFERENCE 97067  (1) D350-748-201 CROSSTUBE REFERENCE 97066  CONTENANT: 1 NIL

Operation	Temp. spécifiée Specified Temp	Temps de trempe Spécifié Specified Soak Temp	Atmosphère	Carbone Carbon Potential	Q-Media Q-Temp	Four # Furnace #	Date Départ Start Date	Heure d'entrée Time In	Heure de sortie Time Out	Date Complétée Date complete
1.00 CONT. INIT.	LAVAGE		si nécessaire							

# METCOR INC.

560 BOUL. ARTHUR-SAUVÉ  
ST-EUSTACHE, QC, J7R 5A8

Tel: 450-473-1884 / Fax: 450-491-5498

## Certificat de Conformité Détaillé

Detailed Certificate of Compliance

BON DE TRAVAIL order	CHARGEMENT load
184354	1

CLIENT / customer 215

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

LIVRÉ À / shipped to:

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

Operation	Temp. spécifiée Specified Temp	Temps de trempage Spécifié Specified Soak Temp	Atmosphere	Carbone Carbon Potential	Q-Media Q-Temp	Four # Furnace #	Date Départ Start Date	Heure d'entrée Time In	Heure de sortie Time Out	Date Complétée Date complete
2.00 PREPARING	COMPTAGE									
3.00 STRESS RE	343°C+/-6°C	2:00	air			701				
4.00 FINAL INSP							03-07-2013			03-07-2013

### COMMENTAIRES / comments

LES TRAITEMENTS THERMIQUES SUR CETTE COMMANDE A ÉTÉ FAIT EN UTILISANT DES ÉQUIPEMENTS EN CONFORMITÉ AVEC LES REQUIS DE LA SPÉCIFICATION AMS2759.

TOUTES LES OPÉRATIONS DE TRAITEMENT THERMIQUE ONT ÉTÉ FAITES EN CONFORMITÉ AVEC LES REQUIS DE LA SPÉCIFICATION DEMANDÉE ET TOUTES LES VÉRIFICATIONS ET LES TESTS DEMANDÉS ONT ÉTÉ FAITES ET DOCUMENTÉS.

AUCUN CHANGEMENT OU DÉROGATION N'A ÉTÉ FAITE PAR RAPPORT AU TRAITEMENT THERMIQUE DEMANDÉ. ON CERTIFIE QUE LE MATÉRIEL A ÉTÉ FABRIQUÉ, ÉCHANTILLONNÉ, TESTÉ ET INSPECTÉ EN ACCORD AVEC LES SPÉCIFICATIONS DU MATÉRIEL ET LE BON DE COMMANDE ET LE MATÉRIEL RENCONTRE LES EXIGENCES SPÉCIFIÉS.

ACCOMPLISHED USING HEAT TREATMENT EQUIPMENT THAT MEETS THE REQUIREMENTS OF AMS 2759. ALL THE HEAT TREATMENT OPERATIONS WERE ACCOMPLISHED IN ACCORDANCE WITH THE REQUESTED/REQUIRED HEAT TREATMENT SPECIFICATION AND ALL REQUIRED VERIFICATIONS TEST HAVE BEEN PERFORMED AND DOCUMENTED. NO UNAUTHORIZED CHANGES OR ALL THE HEAT TREATMENT PROCESSING PERFORMED ON THIS ORDER WAS DEVIATIONS TO REQUIRED HEAT TREATMENT SPECIFICATIONS OR PROCEDURES HAVE BEEN PERFORMED.

WE CERTIFY THAT THE MATERIAL WAS MANUFACTURED, SAMPLED, TESTED AND INSPECTED IN ACCORDANCE WITH THE MATERIAL SPECIFICATION AND THE PURCHASE ORDER AND WAS FOUND TO MEET THE REQUIREMENTS.

APPROUVÉ par / Approved by:

*Isabel Oler*



DATE: 2013-03-14

/ Nous certifions que toute l'information comprise sur ce rapport est exacte et conforme aux requis du client. / We certify that all the information on this report is exact and in accordance with the order requirements.

# METCOR INC.

560 BOUL. ARTHUR-SAUVÉ  
ST-EUSTACHE, QC, J7R 5A8

Tel: 450-473-1884 / Fax: 450-491-5498

## Certificat de Conformité Détaillé

Detailed Certificate of Compliance

BON DE TRAVAIL order	CHARGEMENT load
184419	1

CLIENT / customer 215

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

LIVRÉ À / shipped to:

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

1

COMMANDE DU CLIENT customer po	BON DE LIVRAISON DU CLIENT customer shipper no.	MATÉRIEL material	CODE DE TRAITEMENT mat'l heat code	NUMÉRO DE LOT lot number
PO19282				
<u>SPÉCIFICATIONS DU PROCÉDÉ</u> processing specifications				
STRESS REL				
SAE AMS 2759/1 REV.E				
EXIGENCE / requirement SPÉCIFICATIONS / specified TESTS EXÉCUTÉS / performed RÉSULTATS DE TESTS / results				
Visual				





**CERTIFICATE OF  
CONFORMANCE**

**CADORATH PLATING CO. LTD.  
2150 LOGAN AVENUE  
WINNIPEG, MANITOBA R2J-0J1**

**DATE:** Apr-08-2013

**CONSIGNEE TO:** Dart Aerospace Ltd.  
1270 Aberdeen St.  
Hawksbury, ON K6A 1K7

**W/O #:** 123432

**INVOICE #:** 65407

**CONTRACT OR  
PURCHASE ORDER #** PO19388

**DESCRIPTION:** CROSSTUBE

**P/N #** D350-748-201

**QTY** 1

**S/N #** 97067

MPI IAW ASTM-E-1444. CADMIUM PLATING IAW AMS-QQ-P-416C  
TYPE 2 YELLOW CLASS 1. FINAL MPI IAW ASTM-E-1444. BAKE  
HEAT CHART # 13-286 AND # 13-307.

*S 13/07/11*

**CERTIFICATE: I certify that the items indicated here on have  
been inspected and tested and conform to all specifications  
and requirements detailed on the contract or purchase order.**

CI  
22

**Approved Inspector:**



**CERTIFICATE OF  
CONFORMANCE**

**CADORATH PLATING CO. LTD.  
2150 LOGAN AVENUE  
WINNIPEG, MANITOBA R2J-0J1**

**DATE:** May-13-2013

**CONSIGNEE TO:** Dart Aerospace Ltd.  
1270 Aberdeen St.  
Hawksbury, ON K6A 1K7

**W/O #:** 124596  
**INVOICE #:** 65948

**CONTRACT OR  
PURCHASE ORDER #** PO19783

**DESCRIPTION:** CROSSTUBE

**QTY** 1

**P/N #** D350-748-201

**S/N #** 97067

STRIP IAW MIL-STD-871. CADMIUM PLATING IAW AMS-QQ-P-416C  
TYPE 2 YELLOW CLASS 1. MPI IAW ASTM-E-1444. BAKE HEAT  
CHART # 13-415 AND # 13-428.

**CERTIFICATE:** I certify that the items indicated here on have  
been inspected and tested and conform to all specifications  
and requirements detailed on the contract or purchase order.



**Approved Inspector:** \_\_\_\_\_



## LIQUID PENETRANT TEST REPORT

P- 09103

CLIENT DART AeroSpace DATE MAY 17/13 PAGE 1 OF 1  
ATTENTION ANDY SHELTON ACUREN JOB NO. 188-13-C0098 TIME AM ☒ PM ☐  
ADDRESS 1220 ABERDEEN ST. PO/WO NO. 19926 -  
NAWKESBURY CN. WORK LOCATION SAME  
ACCEPTANCE STD. ASTM 1417/051-038 REV./DATE 2005  
PROJECT F.P.I. on CROSS TUBES  
ITEM(S) EXAMINED (10)

JOB DESCRIPTION PROCEDURE NO. LT-1002 REV./DATE 2008 TECHNIQUE NO. LT-1002 REV./DATE 2008  
PART NO. SEE RESULTS MATERIAL STEEL THICKNESS VARIABLE  
SCOPE A WET FLOUORESCENT INSPECTION WAS CARRIED OUT ON THE  
SURFACE ONLY 100% WITH (DYE)

TEST DETAILS  
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED  
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 16459 ☐ OUTPUT > 1000  $\mu$ W/cm<sup>2</sup> ☐ AMBIENT < 2 fc  
PENETRANT 2LG7 MINIMUM DWELL TIME 10 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☒ OUTPUT > 100 fc @ SURFACE  
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER  
DEVELOPER SKD 12 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N CAL DUE DATE  
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE  
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL  
SURFACE TEMPERATURE ☐ < -4°C/20°F ☐ -4°C/20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS-		<input checked="" type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL		ACCEPT	REJECT	
ITEM	COMMENTS					
	CROSS TUBE - W.O.#					
1	" " 97119			✓		
1	" " 95011			✓		
1	" " 95003				X	ONE INDICATION
1	" " 97065			✓		
1	" " 95010			✓		
1	" " 97067			✓		
1	" " 95009			✓		
1	" " 95041			✓		
1	" " 97068			✓		
1	" " 95004			✓		

Scope of Services  
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.  
Standard of Care  
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE Andy Sheldon DTR # E-02100  
TECHNICIAN (SIGNATURE): Mike Johnson REPORT REVIEWED BY:  
NAME (PRINT): Mike Johnson NAME INITIALS  
CGSB LEVEL 2 SNT LEVEL 2 CGSB LEVEL 2 SNT LEVEL 2  
CGSB REG. NO. 0006 CGSB REG. NO. 0006

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

PT Sept 2005

Work Order ID 97067

February 14 13 1:32:25 PM

\*97067\*

Item ID: D350-748-201

Accept

\*N9000040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Aft

Start Date: 2/14/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 3/08/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: *MLS*  
QC:

Date: *130215* Tooling:

Date:

Run Start \*NR1\*

Date: SPC (Y/N):

Date:

Stop \*NR2\*

Sequence ID/  
Work Center ID Operation  
Description

Set Up/  
Run Hours

Tool ID Tool # Plan  
Code Accept Reject Reject Insp.  
Qty Qty Number Stamp

Draw Nbr Revision Nbr

D350-748-241 G

*MLS 17-05-28*

100  
\*100\* DOCUMENT CONTROL

0.00

DC Memo 0.00  
Document Control Photocopy bluefile & type labels per PPPD350-748-201 CHG003

110  
\*110\* BENDING MACHINE - CROSSTUBES

0.00

CNC Bend 2 Memo 0.00  
CNC Alpha 160 Bender Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT  
\*\*\*\*\*UNDER BEND .225" PER SIDE\*\*\*\*\*

\*\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*\*

*13-3-6*

## 5.0 PARTS LIST

*smf*

**REFERENCE ONLY**

Qty -101	Qty -201	Part Number	Description
X		D350-748-101	CROSSTUBE INSTALLATION, AS 350/355 HIGH FWD
	X	D350-748-201	CROSSTUBE INSTALLATION, AS 350/355 HIGH AFT
1		D350-748-141	CROSSTUBE ASSEMBLY, AS 350/355 HIGH FWD
	1	D350-748-241	CROSSTUBE ASSEMBLY, AS 350/355 HIGH AFT
*2	*2	D3502-1	SUPPORT
*2	*2	D2856-400-710	ABRASION STRIP
*1	*1	AELS-1032-225	INSERT
*2	*2	MS21920-20	CLAMP
*1	*1	MS27039-1-10	SCREW
*1	*1	AN960JD10	WASHER
4	4	D3500-1	SADDLE
16	16	D3501-1	BUSHING
16	16	AN4-6A	BOLT
8	8	AN4-41A	BOLT
4	4	AN5-32A	BOLT
32	32	AN960JD416	WASHER
8	8	AN960JD516	WASHER
24	24	MS21042L4	NUT (OR MS21042-4)
4	4	MS21042L5	NUT (OR MS21042-5)

\* REFERENCE ONLY. PARTS ARE INCLUDED IN D350-748-141/241 ASSEMBLIES ABOVE

Work Order ID 95004

January-02-13 11:48:43 AM

\*95004\*

Item ID: D350-748-201

Accept

Revision ID:

Item Name: Crosstube Installation, High Aft

Start Date: 1/21/13

Start Qty: 1.00

\*1\*

Required Date: 1/21/13

Req'd Qty: 1.00

\*1\*

Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan: *MLJ*

Date: *13-01-03* Tooling:

Date:

Run

Start

\*NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

\*NR2

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Start

Draw Nbr

Revision Nbr

D350-748-241

G

100

0.00

\*100\*

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile & type labels per PPPD350-748-201

CHG003

110

\*110\*

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

0.00

Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio ET

\*\*\*\*\*UNDER BEND .225" PER SIDE\*\*\*\*\*

\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*

*13-3-7*